VYNCO

INSTALLATION INSTRUCTIONS

INDUSTRY 10A-15A CONNECTOR

VICS SERIES

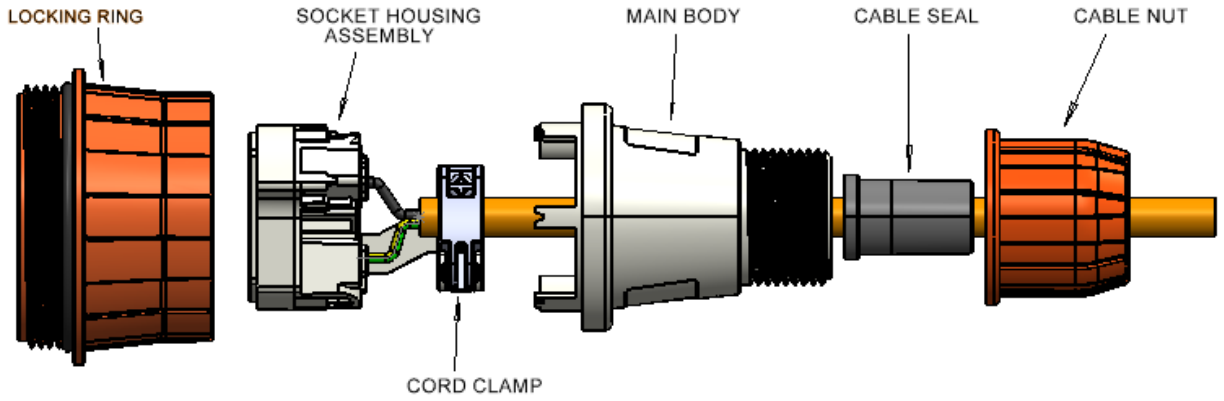

Pin shape		Flat
IP Rating		IP66
Code	**Voltage (V)**	**Current (A)**
VICS310	250V a.c.	10A
VICS315	250V a.c.	15A

Suitable for indoor & exposed outdoor use.

For all other specifications for the INDUSTRY range, refer to our website, www.vynco.co.nz

SAFETY

Please read all instructions prior to wiring and use of this product.

This product complies in full with the relevant AS/NZS standards.

Always ensure power is switched off/isolated on circuit before installation, internal cleaning or maintenance.

This product contains NO user serviceable parts.

Do not attempt to modify this fitting in any way.

This product should be wired up by a suitably qualified person in accordance with Australian and New Zealand wiring rules AS/NZS 3000.

CLEANING INSTRUCTIONS

To maintain the durability and longevity of the product, neutral based chemicals are best suited.

WARRANTY

The warranty protects against defects in workmanship and material. Any defects will be rectified by replacement if the goods are returned to place of purchase, with proof of purchase, and with a brief explanation of the experienced fault.

The warranty does not include compensation for any associated expenses involving installations or removal, such as labour or travel.

The warranty becomes null and void if, in our opinion, the product has been misused, tampered with, incorrectly installed, or subjected to power surges.

VYNCO INDUSTRIES (NZ) LIMITED

CHRISTCHURCH
388 Tuam Street, Phillipstown, Christchurch, 8011
PO Box 9022, Tower Junction, Christchurch 8149
New Zealand
P +64 3 379 9283 F +64 3 379 6838
E sales@vynco.co.nz

AUCKLAND
9 Levene Place, Mount Wellington
PO Box 12 249, Penrose, Auckland 1061
New Zealand
P +64 9 525 6051 F +64 9 525 5799

VYNCO.CO.NZ

VYNCO

INSTALLATION INSTRUCTIONS

INDUSTRY 10A-15A CONNECTOR

VICS SERIES

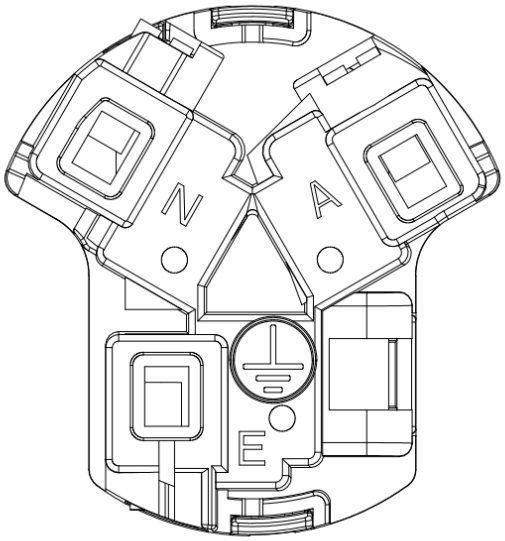

RECOMMENDED CORD SIZES		
	MIN CABLE DIA	MAX CABLE DIA
VICS310	0.75mm^2 Dia 6.8mm	1.5mm^2 Dia 12.0mm
VICS315	1.0mm^2 Dia 7.0mm	2.5mm^2 Dia 12.0mm

CABLE STRIPPING DETAILS 10A / 15A

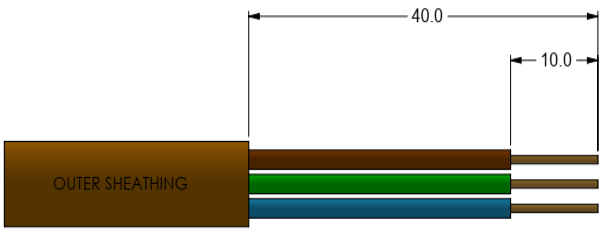

WIRING INSTRUCTIONS

1. Strip back insulation on wires as shown in diagram.
2. Slide Cable nut, cable seal and main body over the cable
3. Connect the earth wire (**green/yellow or all green**) to terminal marked **E** with green indication.
4. Connect **blue or black** wire to neutral terminal marked **N.**
5. Connect **red or brown** wire to phase terminal marked **A.**
6. Connect the cord clamp to the outer sheath allowing 7-10mm of outer sheathing cable to protrude through the clamp. Tighten screw firmly.
7. **Check again that the wires are fitted to the correct terminals and screws are tight.**
8. Place the Socket housing assembly into the main body and firmly screw both parts together.
9. Slide the cable seal and cable nut down the cable. Tighten the cable nut to ensure a tight seal of the cable into the main body.

VYNCO INDUSTRIES (NZ) LIMITED

CHRISTCHURCH
388 Tuam Street, Phillipstown, Christchurch, 8011
PO Box 9022, Tower Junction, Christchurch 8149
New Zealand
P +64 3 379 9283 F +64 3 379 6838
E sales@vynco.co.nz
VYNCO.CO.NZ

AUCKLAND
9 Levene Place, Mount Wellington
PO Box 12 249, Penrose, Auckland 1061
New Zealand
P +64 9 525 6051 F +64 9 525 5799